

wineo

Below we would like to inform you about the special requirements for a successful installation of **PURLINE wineo 1500 roll for gluing**. Please note that polyurethane flooring is a separate product category according to EN 16776 and follow the installation instructions. For further information, please refer to the technical specifications in our product collections.

Before processing, make sure that the delivered goods are in perfect condition. The rolls must be stored upright. Cut or misplaced goods are excluded from complaints. Prior to installation, the goods must be checked for colour and batch uniformity. Only lay rolls of the same batch in the same room.



- major unevenness
- insufficiently dry subfloor.
- insufficiently firm, too porous and too rough surface of the subfloor,
- contaminated surface of the substrate, e.g. by oil, wax, varnish, paint residues,
- incorrect height of the surface of the substrate in relation to the height of adjoining components,
- unsuitable temperature of the substrate,
- unsuitable room climate,
- missing heating protocol for heated floor constructions,
- missing protrusion of the edge insulation strip,

Installation instructions roll for gluing

- missing marking of measuring points for heated floor constructions,
- missing joint plan.

You will need the following tools for the installation:

- Hygro-Tthermometer
- Pencil
- Scale
- Dolphin knife with hook and trapezoid blade
- Chalk Line
- Edge Cutter
- Adhesive Spatula with A2 Teeth Adhesive
- Linocut
- Hand Pressure Roller
- Pressure Board
- Sectional Roller min. 50 KG (110lbs)



Substrate:

In order to level out unevenness and to obtain an evenly absorbent substrate, it is recommended to apply a suitable levelling compound in sufficient layer thickness using the squeegee technique. Non-absorbent substrates or substrates that are blocked against rising damp must be levelled with a layer thickness of at least 3 mm. Please observe the instructions of the building material suppliers. When bonding **wineo 1500 roll for gluing** to underfloor heating systems, EN 1264-2 (Room Surface Integrated Heating and Cooling Systems with Water Flow Part 2) must be taken into account in addition to national requirements. The surface temperature should not exceed 27°C permanently.




Acclimatisation:

Installation instructions roll for gluing

Wineo 1500 roll for gluing must be cut to size and laid out in the rooms to be laid at least 24 hours before installation under the following conditions (3), which ensures optimum laying out of the strips. If the room conditions do not allow for laying out, the product can also be acclimatised standing loosely rolled up after cutting. Laying aids must also be acclimatised.

Room climatic requirements:


- Air temperature in the room > 18°C (but not more than 25°C)
- Floor temperature > 15°C (but not more than 25°C)
- Relative humidity < 65%

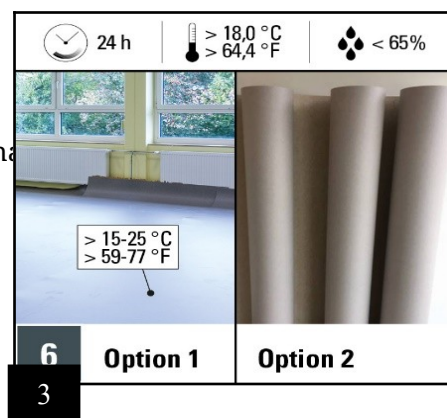

It must be ensured that constant room climatic conditions exist during the acclimatisation as well as the setting phase of the adhesive. The above-mentioned room climate must be maintained for at least 72 hours before, during and after bonding the covering. The underfloor heating must be kept at a constant 18-22°C during this time.

Installation:

wineo 1500 roll for gluing should be laid in the same direction. The factory edges must always be trimmed before laying (4). Lay out the floor covering lengthwise with an overlap of approx. 2.0cm (3/4") per strip for the subsequent seam cut (5). In the case of wood decors, it is not mandatory to pay attention to the repeat, however, a length allowance of at least 10 cm per strip should be made so that an offset of the wood joints on the front side can be guaranteed. When cutting the seam, make sure that the cut runs directly next to the wood joint and that the wood joint remains on the other side. If the flooring is to be grouted at a later date, the seam the seam cut should run directly in the wood joint.

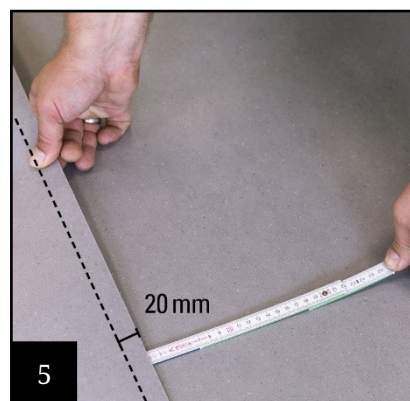


Now beat or roll the sheets back to the centre of the room (6). In order to achieve a straight adhesive approach, a beating cord should be used (7).


PURLINE wineo 1500

Installation instructions roll for gluing

wineo


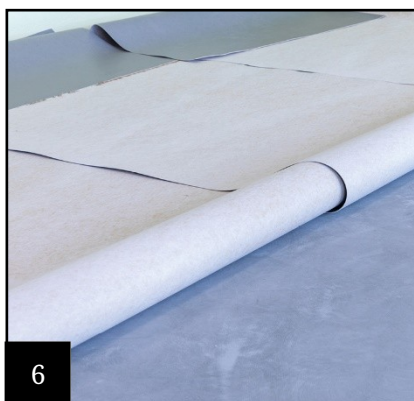


Now apply the adhesive approved by Windmüller GmbH evenly and lane by lane according to the adhesive manufacturer's instructions using the TKB toothed strip (usually TKB A2 toothing) recommended for this purpose (8).

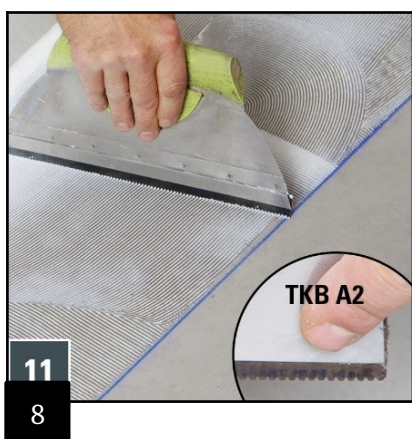

Now push the sheets approx. 10cm into the fresh adhesive to avoid visible glue marks later (9). Proceed in the same way on the opposite side.

Allow the adhesive to flash off according to the manufacturer's instructions, taking into account the room climate conditions. Now place the covering in the adhesive bed in the "tack phase" (10). (Attention: no adhesive bed bonding).

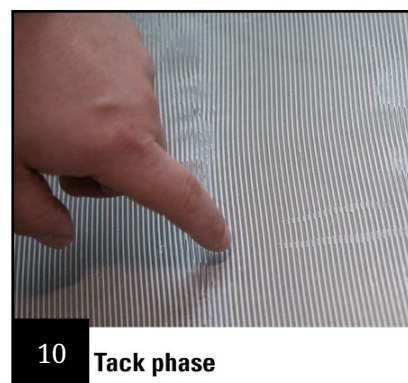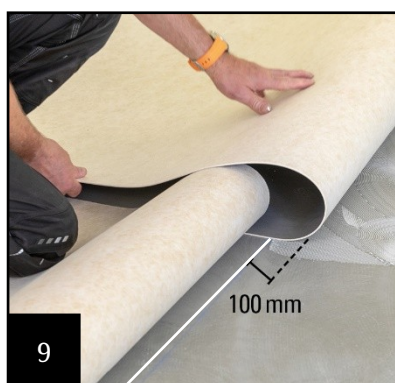


Installation instructions roll for gluing

In order to achieve an optimum installation result, the covering must be carefully rubbed from the centre to the sides immediately after it has been placed (11) in the adhesive bed. (e.g. cork or surface scraper) from the centre to the sides (12).




11

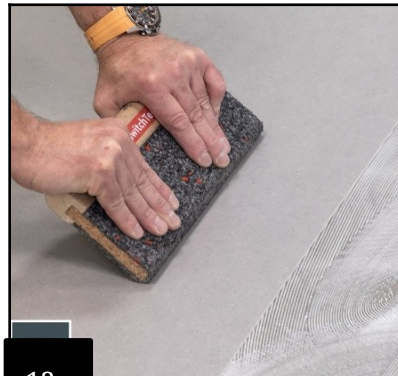


12

Seam cut:

Cut the seam directly after inserting and rubbing the covering with a suitable seam cutter (e.g. "Linocut" or seam ripper) (13) to a distance of approx. 0.5 mm (14) between the covering edges (15) and press the seam again with a seam roller (16). Seams that will not be grouted later can be cut tight to 0.3 mm without compression. Due to different climatic conditions at the construction sites, as well as the associated reaction times of the adhesives used, a larger seam spacing may be necessary. If necessary, a test bonding should be carried out.

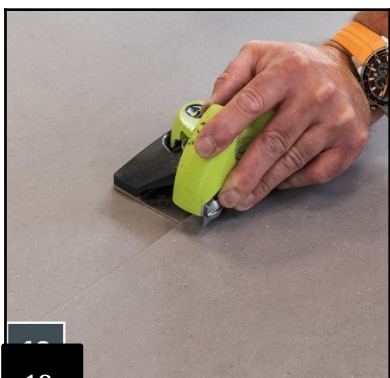

13

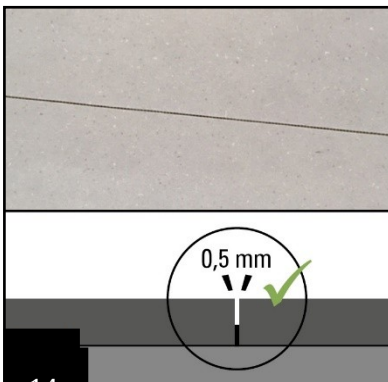


14



15



16

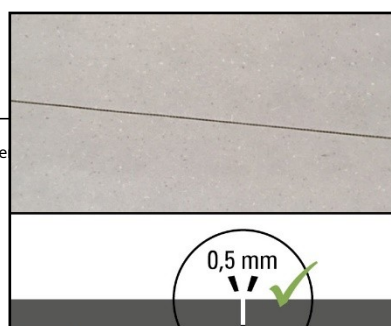


PURLINE wineo 1500

Installation instructions roll for gluing

wineo

Afterwards, but not later than 30 minutes after manual rubbing, the covering is evenly and slowly rolled (17) using an articulated roller (weight min. 50 kg / 110lbs). Check that the covering is sufficiently wetted (18) with adhesive.

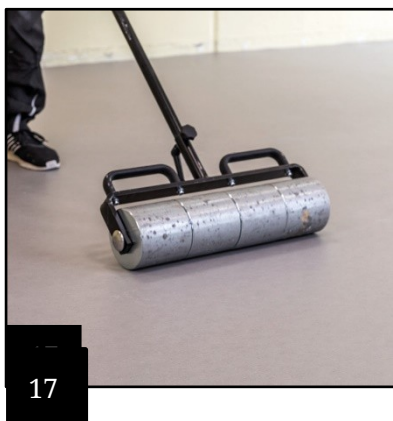

Now cut the covering all around (19) so that the edge joints remain open to avoid sound bridges and compression on walls and door frames. After the partial surface has been laid and all seams have been cut, carefully roll the surface and all edge areas once again (20). Now knock back the flooring from the opposite side as well. Avoid adhesive transfer at the cover edge of the covering. After the appropriate flash-off time, push the covering into the adhesive bed, strip by strip, and carefully rub and roll the covering as described above.



Installation instructions roll for gluing

Thermal sealing of the seam edges in hygienic and damp areas is generally recommended; this must be carried out no earlier than 24 hours after installation or after the adhesive has set (follow manufacturer's instructions).

Thermische Verfugung:

Mill the flooring seams to a minimum depth of 2.0 mm and a maximum width of 3.5 mm. Seams in edge areas must be gouged to the appropriate width and depth using a suitable joint extractor



Set the welding machine to approx. 450°C. Use a 5.0mm speed welding nozzle to insert the fusion wire.



While still warm, push off half of the fusible link with the "Mozart" push-off knife with spacer plate (0.7mm). Allow the remaining, excess fusible link to cool completely and then push it off flush with the surface of the floor covering using the "Mozart" push off knife without spacer plate.



PURLINE wineo 1500

Installation instructions roll for gluing

wineo

2-K joint material:

Sealing the covering joints with 2-component joint sealants is possible, if required, after prior consultation with the Windmüller GmbH application technology department.

- The installed surface should only be put into operation/loaded after the adhesive has completely set (follow the adhesive manufacturer's instructions). Please note that the contractor has a maintenance obligation (protection of the floor covering from damage by subsequent trades) for a completed but not yet accepted trade. Please use only vapour-open covering material.

Through partial acceptance, the maintenance obligation for the accepted areas is transferred to the client.

Cleaning and maintenance:

Please refer to our detailed cleaning and cleaning agent recommendations at www.wineo.de!

- With the publication of these installation instructions (as of 09/2026), all previous versions lose their validity.